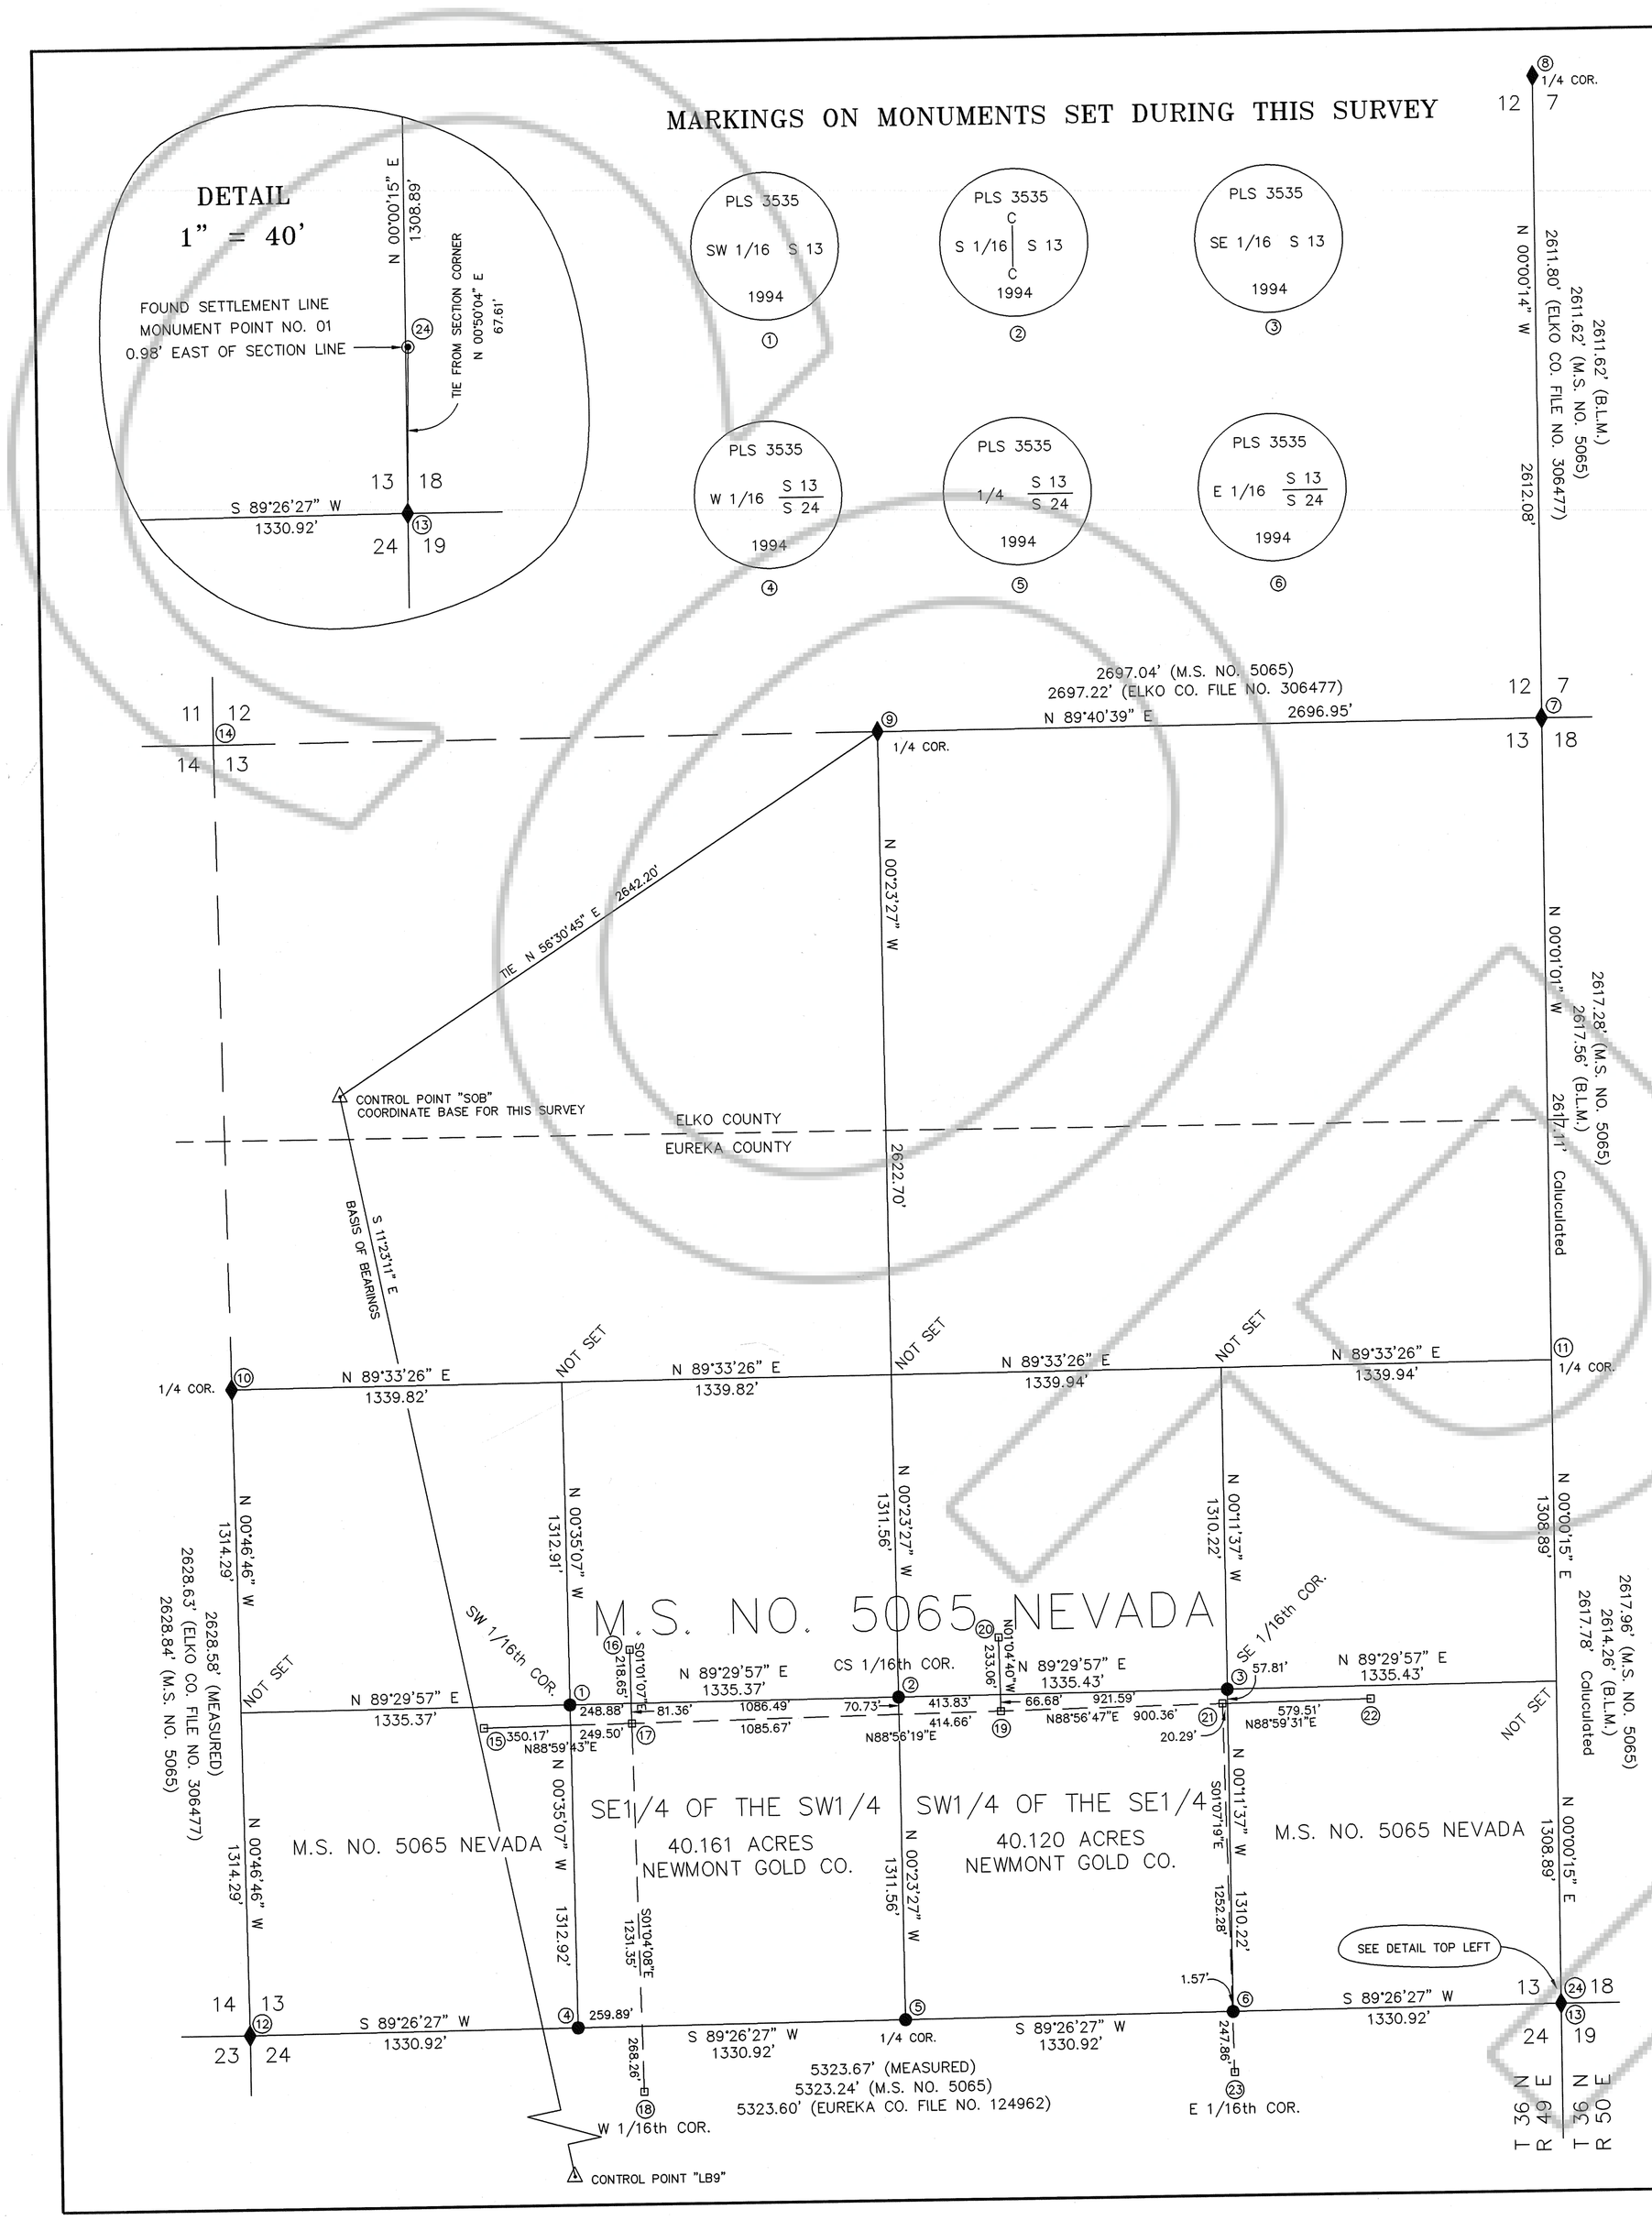

MONUMENT NOTES

1. MONUMENT SET TO PERPETUATE PRIVATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

2. MONUMENT SET TO PERPETUATE PRIVATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

3. MONUMENT SET TO PERPETUATE PRIVATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

4. MONUMENT SET TO PERPETUATE PRIVATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

5. 1/4 COR. MONUMENT SET BY SINGLE PROPORTION METHOD TO PERPETUATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

6. MONUMENT SET TO PERPETUATE PRIVATE PROPERTY BOUNDARY CORNER. SEE CAP MARKINGS AT LEFT.

7. FOUND PREVIOUS MONUMENT, AN RLS 6805 BRASS CAP ON STEEL PIPE WITH BLM STAMP ADDED, INDICATED ON ELKO COUNTY MAP FILE NO. 306477 (EUREKA COUNTY MAP FILE NO. 136733). THE MONUMENT DESCRIPTION ON FILE NO. 306477 WAS INCORRECT AND SHOULD HAVE REFERENCED THE EUREKA COUNTY CORNER RECORD CITED BELOW. THE MONUMENT WAS ALSO RECOVERED AND REFERENCED ON MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENTS AT BK. 36–49, PG. J–25, EUREKA COUNTY, AND ELKO CO. CORNER RECORD FILED UNDER SECTION 12, T36N, R49E. THIS CORNER WAS UTILIZED TO REESTABLISH, BY SINGLE PROPORTION, THE E 1/4 CORNER OF SECTION 13.

8. FOUND PREVIOUSLY SET MONUMENT, AN RLS 6805 BRASS CAP WITH BLM STAMP ADDED, INDICATED ON ELKO COUNTY MAP FILE NO. 306477 (EUREKA COUNTY MAP FILE NO. 136733). THE MONUMENT DESCRIPTION ON FILE NO. 306477 WAS INCORRECT AND SHOULD HAVE REFERENCED THE EUREKA COUNTY CORNER RECORD CITED BELOW. THE MONUMENT WAS ALSO RECOVERED AND REFERENCED ON MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENTS AT BK. 36–49, PG. G–25, EUREKA COUNTY, AND ELKO CO. CORNER RECORD FILED UNDER SECTION 12, T36N, R49E.

9. 3 1/4" ALUM. CAP STAMPED "PLS 3535", A PREVIOUSLY SET MONUMENT REFERENCED ON ELKO COUNTY MAP FILE NO. 306477 (EUREKA CO. NO. 136733) AND MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENT FILED WITH ELKO COUNTY UNDER SEC. 12, T36N, R49E. THE MONUMENT WAS USED TO CONTROL THE SUBDIVISION OF SECTION 13.

10. 3 1/4" ALUM. CAP STAMPED "PLS 3535", A PREVIOUSLY SET MONUMENT REFERENCED ON ELKO COUNTY MAP FILE NO. 306477 (EUREKA CO. NO. 136733) AND MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENT FILED AT BK. 223, PG. 036, EUREKA COUNTY. THE MONUMENT WAS USED TO CONTROL THE SUBDIVISION OF SECTION 13.

11. PREVIOUSLY SET MONUMENT REFERENCED ON U.S. MINERAL SURVEY NO. 5065 WAS DESTROYED BY MINING ACTIVITY. SEE CORNER RECORDATION DOCUMENT AT BK. 36–49, PG. L–25, EUREKA COUNTY CORNER RECORDS. A PORTION OF THE MINERAL SURVEY NO. 5065 PLAT DIMENSIONS ALONG THE RANGE LINE WAS USED TO REESTABLISH THE POSITION TO CONTROL THE SUBDIVISION OF SECTION 13. THE CORNER WAS NOT REMONUMENTED.

12. 3 1/4" BRASS CAP STAMPED "RLS 6805", A PREVIOUSLY SET MONUMENT REFERENCED ON ELKO COUNTY MAP FILE NO. 306477 (EUREKA CO. NO. 136733), EUREKA CO. MAP FILE NO. 124962, AND MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENT FILED AT BK. 223, PG. 036, EUREKA COUNTY. MONUMENT WAS USED TO CONTROL THE SUBDIVISION OF THE SW 1/4 OF SECTION 13.

13. 3 1/4" BRASS CAP STAMPED "RLS 6805", A PREVIOUSLY SET MONUMENT REFERENCED ON EUREKA COUNTY MAP FILE NO. 101906, EUREKA COUNTY MAP FILE NO. 124962, AND MINERAL SURVEY NO. 5065. SEE CORNER RECORD DOCUMENT FILED AT BK. 36–49, PG. N–25, EUREKA COUNTY CORNER RECORDS. THIS MONUMENT WAS USED TO REESTABLISH, BY SINGLE PROPORTION, THE E 1/4 CORNER OF SECTION 13, AND CONTROL THE SUBDIVISION OF THE SE 1/4 OF SECTION 13.

14. PREVIOUS MONUMENT REFERENCED ON ELKO CO. MAP FILE NOS. 54489 AND 306477 (EUREKA CO. NO. 136733), AND EUREKA COUNTY MAP FILE NO. 124962, AND MINERAL SURVEY NO. 5065. SEE ELKO COUNTY CORNER RECORD FILED UNDER SEC. 11, T36N, R49E. THIS CORNER WAS NOT A PART OF THIS SURVEY.

15. FOUND M.S. 5065 CAP, GOLDEN APRIL #2/COR. 1

16. FOUND M.S. 5065 CAP, GOLD BUG #1F/COR. 2, GOLDEN APRIL #23/COR. 2

17. FOUND M.S. 5065 CAP, GOLDEN APRIL #2/COR. 4, GOLDEN APRIL #23/COR. 1, GOLD BUG #1F/COR. 1

18. FOUND M.S. 5065 CAP, GOLDEN APRIL #2/COR. 3

19. FOUND M.S. 5065 CAP, GOLD BUG #1F/COR. 4, GOLD BUG #2F/COR. 4

20. FOUND M.S. 5065 CAP, GOLD BUG #1F/COR. 3, GOLD BUG #2F/COR. 3

21. FOUND M.S. 5065 CAP, GOLD BUG #5/COR. 4

22. FOUND M.S. 5065 CAP, GOLD BUG #2F/COR. 1, GOLD BUG #5/COR. 1

23. FOUND M.S. 5065 CAP, GOLD BUG #5/COR. 3

24. FOUND AGREEMENT POINT MONUMENT CAP. REFERENCE IS MADE TO "RECORD OF SURVEY OF THE 1985 SETTLEMENT LINE FOR CARLIN GOLD MINING COMPANY AND WESTERN STATES MINERALS CORP." ELKO CO. MAP FILE NO. 212534, EUREKA CO. MAP FILE NO. 101906

HISTORY OF EARLIER SURVEYS

The Easterly one–half of Township 36 North, Range 49 East, Mount Diablo Meridian was originally surveyed in 1872 by an association of three surveyors; A. J. Hatch, J. H. Eaton and J. C. Smyles. The monumentation set by these surveyors was typically charred wood posts with pits. The Southwesterly portion of the Township was surveyed in 1913 by Winferd A. Pray using standard General Land Office brass caps and marked rocks. The Northwesterly portion of the Township remains unsurveyed. The first modern retracement of the earlier surveys was conducted in 1970 by Mark Chilton on Mineral Survey No. 4901 and a Record of Survey located at File Numbers 50323 and 54489 of the Official Records of Elko County. During 1984 and 1985 Paul N. Scherbel and Mark C. Boge retraced a portion of the range line between R. 49E. and R. 50E. as it relates to a settlement line monumentation. This survey is represented on a Record Of Survey found at File No. 212534 (Elko County) and File No. 101906 (Eureka County). During 1985 and 1986 B.L.M. surveyor Stephen R. Lambeth retraced the Easterly range line of the Township. The next retracement was conducted by Paul N. Scherbel in 1988 as evidenced by a Record of Survey located at File Number 124962 of the Official Records of Eureka County. Summit Engineering, Thomas C. Ballew, retraced Sections 13 through 15, 22 through 28, and 33 through 36 in 1990. As of this date, this survey has not been recorded in either Elko or Eureka Counties. In May 1991 William F. Mueller retraced Sections 11, 12 and 14 and filed a Record of Survey in Elko County at File No. 306477 and Eureka County File No. 136733. U. S. Mineral Surveyor, Don M. McHarg, conducted Mineral Survey No. 5065 in the public domain of Sections 12, 13 and 24 during the Fall of 1991. All of the lines of Section 13 were retraced during this Mineral Survey. All of the above information was used in the retracement of the land shown on this map. Most of the original monumentation set by the original survey was obliterated by numerous range fires since 1872. Corner recovery notes from the Bureau of Land Management and corner recordation information from Elko and Eureka Counties were used in the retracement of this survey.

SURVEYING EQUIPMENT AND ACCURACY

This survey was made with a Topcon electronic total station, Model No. GTS–4A, Serial No. FK0052, which utilizes electronic horizontal and vertical circles that display measured horizontal and zenith angles in degrees, minutes, and seconds. The instrument is certified at one second, horizontal and vertical circle accuracy. Distances were measured with this instrument which uses an infra–red light beam to measure the slope distance from the instrument toward a reflector located at the points to be measured. The slope distance is reduced to horizontal distance which is displayed to a thousandth of a foot. A surveyed control traverse was extended from the control base and was closed upon itself to an accuracy of at least one part in fifty thousand. Sideshots to land corners were made by multiple angle and distance measurements from the established control points. The positional values shown on this survey map are determined to be within 0.10 ft. of the physical field monumentation (based on repeated independent measurements).

LEGEND

- ♦ FOUND SECTION CORNER OR 1/4 SECTION CORNER AS NOTED
- ● SET 2" PIPE WITH 3 1/4" ALUMINUM CAP STAMPED "PLS 3535" AS NOTED STEEL FENCE POST GUARD STAKES WERE PLACED AROUND THE MONUMENTS
- △ FOUND "BGMI" BRASS CAP MONUMENT USED FOR BASIS OF THIS SURVEY
- ▫ FOUND 3 1/4" ALUM CAP, MINERAL SURVEY 5065 MONUMENT
- ◉ INDICATES FOUND 1985 SETTLEMENT LINE MONUMENT, SEE NOTE 24
- ① INDICATES REFERENCE POINT NO. FOR MONUMENT NOTES HEREON

BASIS OF BEARINGS

The Basis Of Bearings for this survey is the Barrick Goldstrike Mines Inc. (BGMI) survey control system. Control Point "SOB" with coordinates of N 19220.495, E 5098.340 was held as the base point. Control Point "LB9" with coordinates of N 6587.870, E 7642.400 was held for the base line endpoint, giving a bearing base of S 11°23'11" E.

SURVEYOR'S CERTIFICATE

I, William F. Mueller, Nevada Professional Land Surveyor No. 3535, hereby certify that this map is an accurate representation of a survey performed under my supervision at the request of Newmont Gold Company. The survey was completed MARCH 15, 1995. I also certify that the monuments are of the character and occupy the positions indicated and are sufficient to retrace the survey. This survey was completed in 1995 and held for internal review by Newmont Gold Company until July, 2002.

PROFESSIONAL LAND SURVEYOR STATE OF NEVADA
7-22-02
WILLIAM F. MUELLER
NO. 3535

N

0 400 800 1200
SCALE: 1"=400'

COUNTY RECORDER INFORMATION

EUREKA COUNTY

File No. 178835

Filed at the request of Frontier Surveying

Date Sept 23, 2002

Time 1:00 P.M.

M.N. Rebalcate
Maxine Stewart, Deputy
Eureka County Recorder $21.00

ELKO COUNTY

File No. 488125

Filed at the request of FRONTIER SURVEYING

Date Sept 17, 2002

Time 3:31 P.M.

Jerry O Reynolds
Becky Jensen Deputy
Elko County Recorder

RECORD OF SURVEY
SE1/4 OF THE SW1/4 AND SW1/4 OF THE SE1/4 OF SEC. 13, T.36N., R.49E., M.D.M.
ELKO and EUREKA COUNTY, NEVADA
FOR NEWMONT GOLD COMPANY

DRAWING INFORMATION	
DRAWN BY MCB/esr	APPROVED BY WFM
JOB NO. 2001006 94020.DWG	DATE 7/11/02

FRONTIER SURVEYING, INC.
1150 LAMOILLE HWY
Elko, Nevada 89801
Phone (775) 738–7970

94020 1/1

DRAWING NUMBER
SAFCO PRODUCTS • NEW HOPE, MINNESOTA
REORDER BY PART NUMBER 85051

DRAWING NUMBER
SAFCO PRODUCTS • NEW HOPE, MINNESOTA
REORDER BY PART NUMBER 85051

DRAWING NUMBER 178835
SAFCO PRODUCTS • NEW HOPE, MINNESOTA
REORDER BY PART NUMBER 85051

DRAWING NUMBER R.O.S. T36N R49E Sec 13 Newmont Gold
SAFCO PRODUCTS • NEW HOPE, MINNESOTA
REORDER BY PART NUMBER 85051