
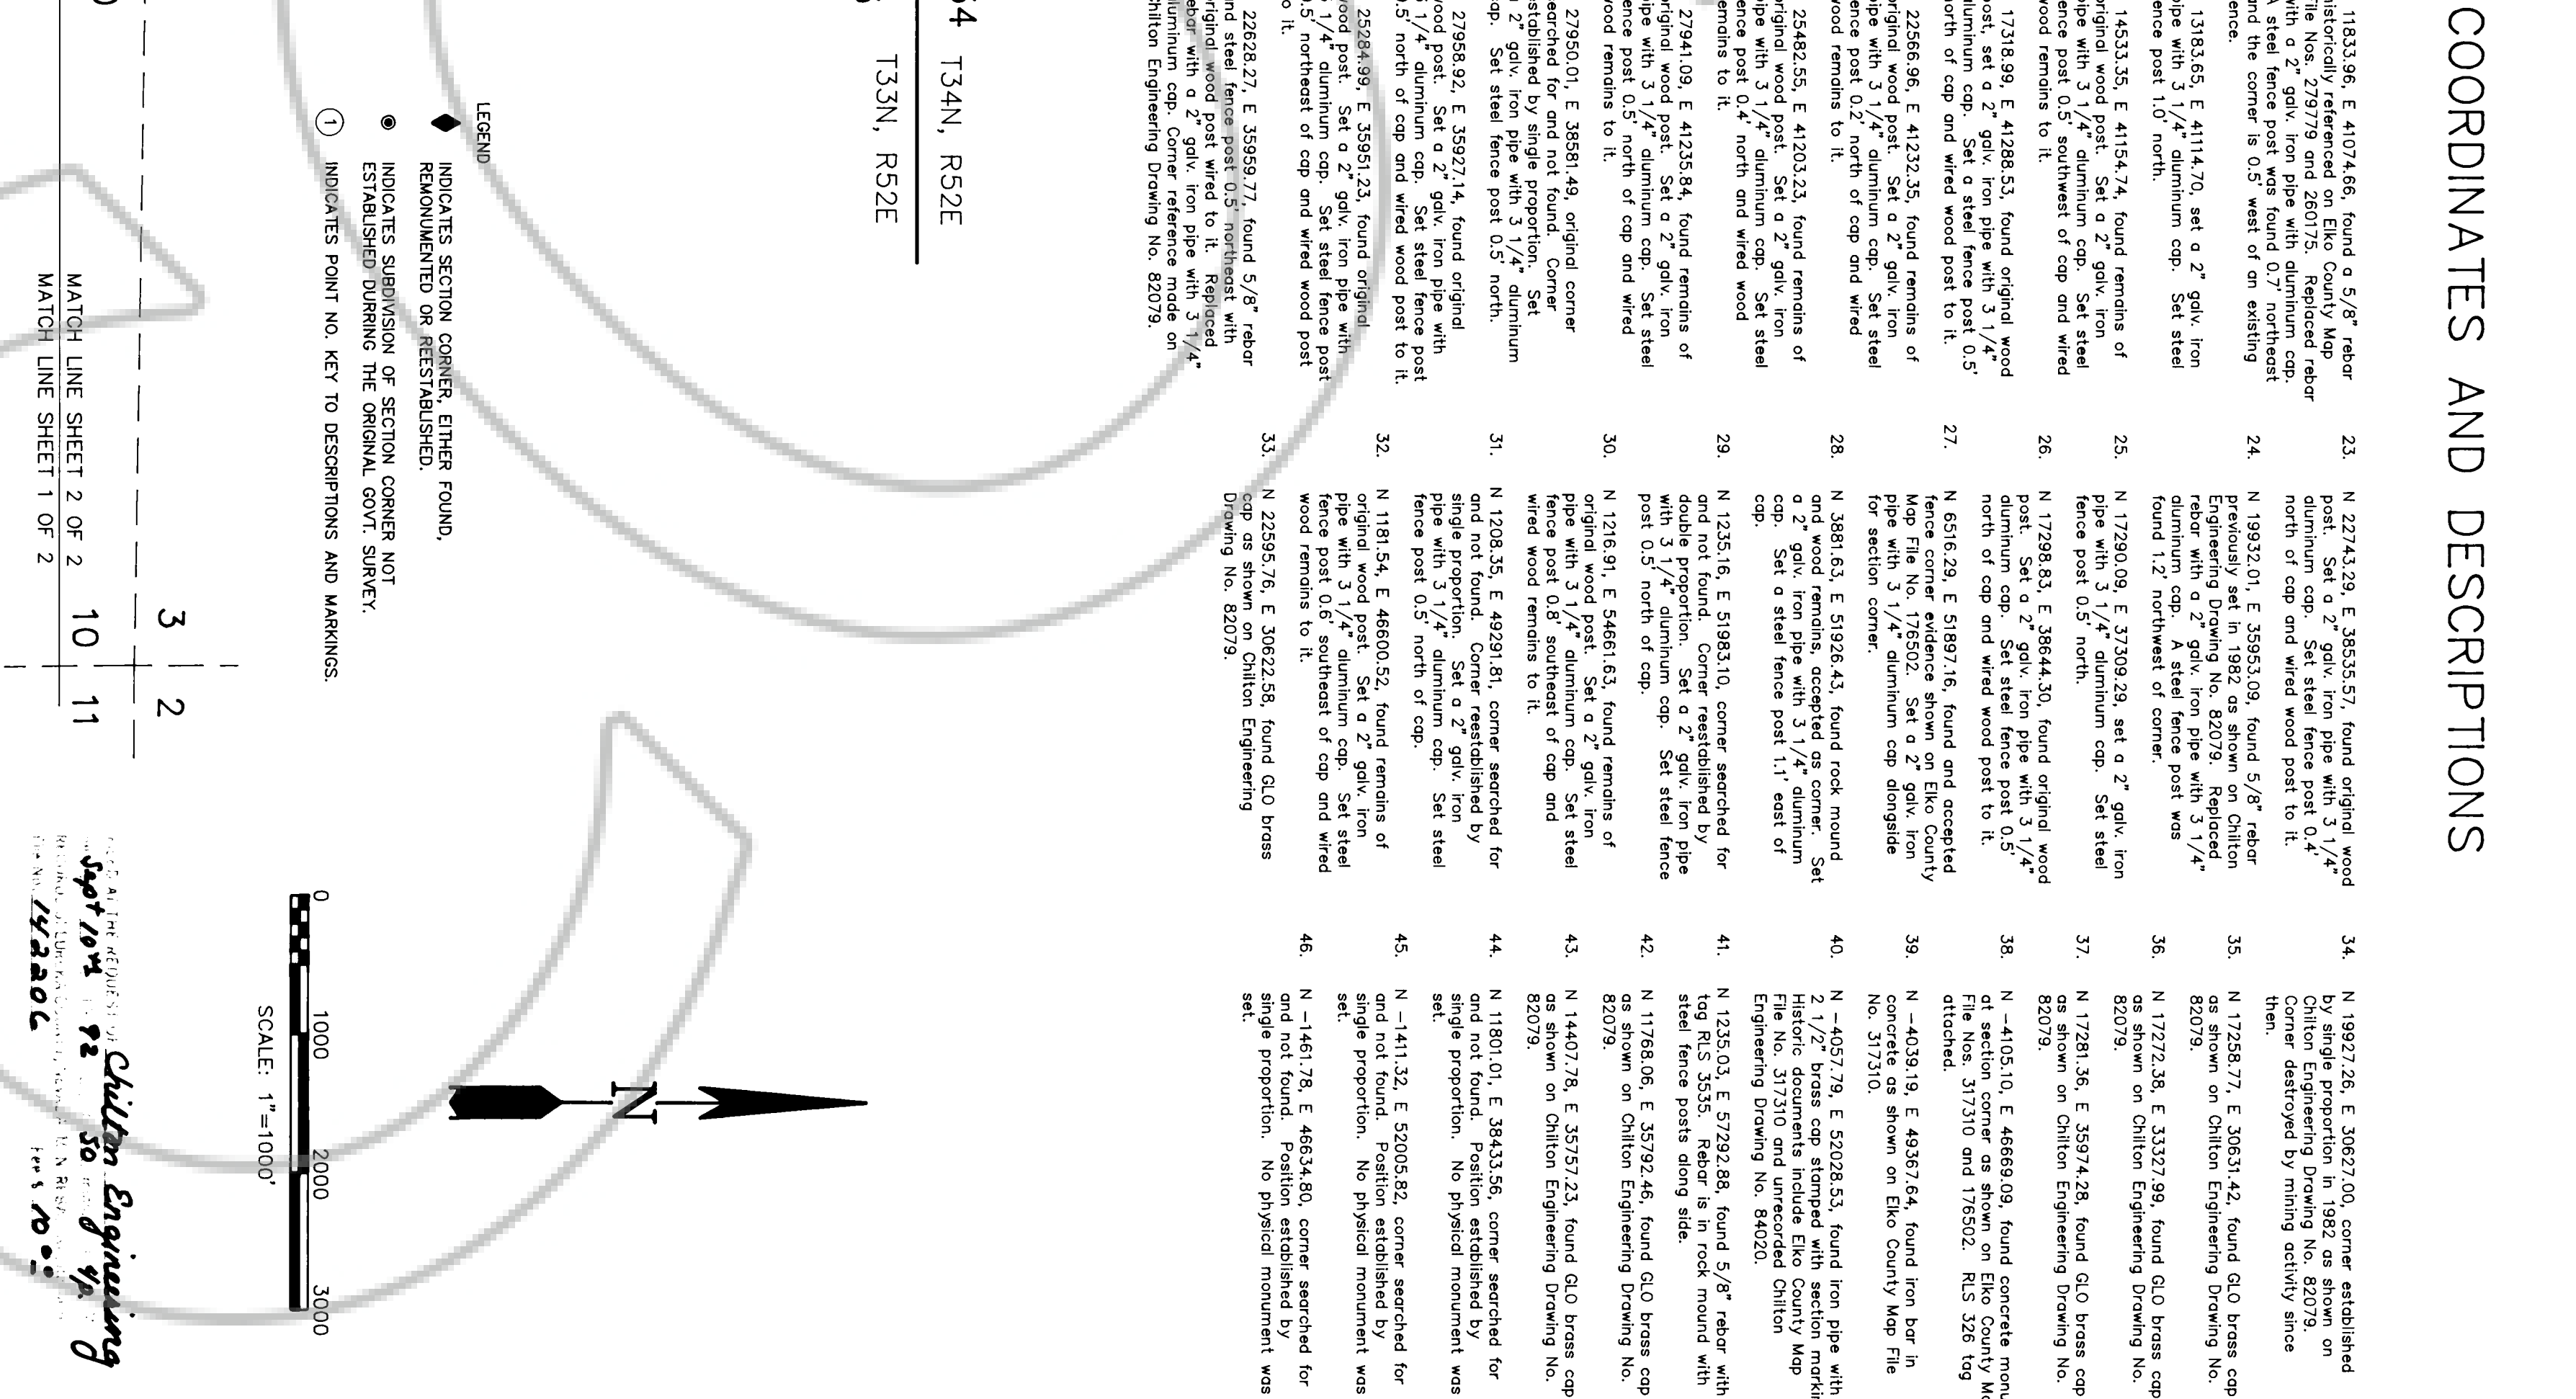


COORDINATES AND DESCRIPTIONS

- | CORNER NUMBER | COORDINATES AND DESCRIPTIONS   |
|---------------|--|
| 1.            | N 6457.48, E 4648.18, found remains of original wood post, set a 2" galv. iron fence post 0.7' west of cap. Set steel  |
| 2.            | N 9104.81, E 4650.50, original corner established by single proportion. Set 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.   |
| 3.            | N 11752.13, E 46518.82, found a 5/8" post wired to a steel fence post 0.5' north. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.   |
| 4.            | N 14359.78, E 46484.43, found 1" iron pipe in mound of rock, determined to be corner. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.   |
| 5.            | N 17329.89, E 46615.04, found a 5/8" rebar with tag RLS 8203. Remains of original wood post found around a steel fence post 0.5' north. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap. |
| 6.            | N 11308.14, E 43989.81, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap and wired wood remains to it.   |
| 7.            | N 14445.92, E 43859.53, set a 2" galv. iron pipe with aluminum cap. Set a steel fence post 0.5' north.   |
| 8.            | N 13119.50, E 43739.24, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set a steel fence post 1.0' north.  |
| 9.            | N 13081.72, E 45140.43, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set a steel fence post 1.0' north.  |
| 10.           | N 11772.80, E 45118.89, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set a steel fence post 1.0' north.  |
| 11.           | N 11703.08, E 43718.86, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set a steel fence post 0.5' north and wired wood remains to it.  |
| 12.           | N 11833.86, E 41074.86, found a 5/8" rebar historically referenced on Elko County Map File No. 176502. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.7' northwest of corner.                           |
| 13.           | N 13181.65, E 4114.70, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 1.0' north.   |
| 14.           | N 14533.35, E 41154.74, found remains of original wood post. Set steel fence post 0.5' southwest of cap and wired wood remains to it.  |
| 15.           | N 17318.89, E 41288.53, found original wood post, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set a steel fence post 0.5' north of cap and wired wood post to it.   |
| 16.           | N 22565.86, E 41232.35, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.2' north of cap and wired wood remains to it.   |
| 17.           | N 25482.25, E 41203.23, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.4' north and wired wood remains to it.  |
| 18.           | N 27941.09, E 41235.84, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap and wired wood remains to it.   |
| 19.           | N 27950.01, E 35851.49, original corner searched for and not found. Corner established by single proportion. No physical monument was set.   |
| 20.           | N 27958.92, E 35927.14, found original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.   |
| 21.           | N 25284.99, E 35951.23, found original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' northwest of cap and wired wood post to it.   |
| 22.           | N 27828.27, E 35859.77, found 5/8" rebar and steel fence post wired to it. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Corner reference made to it.   |
| 23.           | N 22743.29, E 35853.57, found original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap and wired wood post to it.   |
| 24.           | N 19922.01, E 35853.09, found 5/8" rebar historically referenced on Elko County Map File No. 176502. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post was found 1.2' northwest of corner.                   |
| 25.           | N 17390.09, E 37309.28, set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north.  |
| 26.           | N 17298.83, E 38844.30, found original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap and wired wood post to it.   |
| 27.           | N 6516.29, E 51887.16, found and accepted fence corner evidence shown on Elko County Map File No. 176502. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 1.1' east of cap.  |
| 28.           | N 3581.63, E 51926.43, found rock mound and not found. Corner established by single proportion. No physical monument was set.  |
| 29.           | N 1235.16, E 51983.10, corner searched for and not found. Corner established by single proportion. No physical monument was set.   |
| 30.           | N 17161.81, E 54681.63, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.8' southeast of cap and wired wood remains to it.   |
| 31.           | N 1208.35, E 49281.81, corner searched for and not found. Corner established by single proportion. No physical monument was set.   |
| 32.           | N 1181.54, E 48600.52, found remains of original wood post. Set a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.   |
| 33.           | N 22955.78, E 30622.55, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 34.           | N 19927.28, E 30627.00, corner established by single proportion in 1982 as shown on Chilton Engineering Drawing No. 82079. Corner destroyed by mining activity since then.   |
| 35.           | N 17258.77, E 30633.42, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 36.           | N 17272.38, E 33327.98, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 37.           | N 17281.36, E 35974.28, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 38.           | N 4105.10, E 46869.09, found concrete monument of section corner as shown on Elko County Maps File Nos. 317310 and 176502. RLS 326 tag attached.   |
| 39.           | N 4039.19, E 48367.64, found iron bar in mound of rock, determined to be corner. Replaced the rebar with a 2" galv. iron pipe with 3 1/4" aluminum cap. Set steel fence post 0.5' north of cap.  |
| 40.           | N 4057.79, E 52028.53, found iron pipe with tag RLS 3535. Rebar is in rock mound with steel fence posts along side.  |
| 41.           | N 1235.03, E 57292.88, found 5/8" rebar with tag RLS 3535. Rebar is in rock mound with steel fence posts along side.   |
| 42.           | N 11768.05, E 35792.46, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 43.           | N 14407.78, E 35757.23, found G.O. brass cap as shown on Chilton Engineering Drawing No. 82079.  |
| 44.           | N 11801.01, E 38433.56, corner searched for and not found. Position established by single proportion. No physical monument was set.  |
| 45.           | N 4411.32, E 55005.82, corner searched for and not found. Position established by single proportion. No physical monument was set.   |
| 46.           | N 1461.78, E 46534.80, corner searched for and not found. Position established by single proportion. No physical monument was set.   |

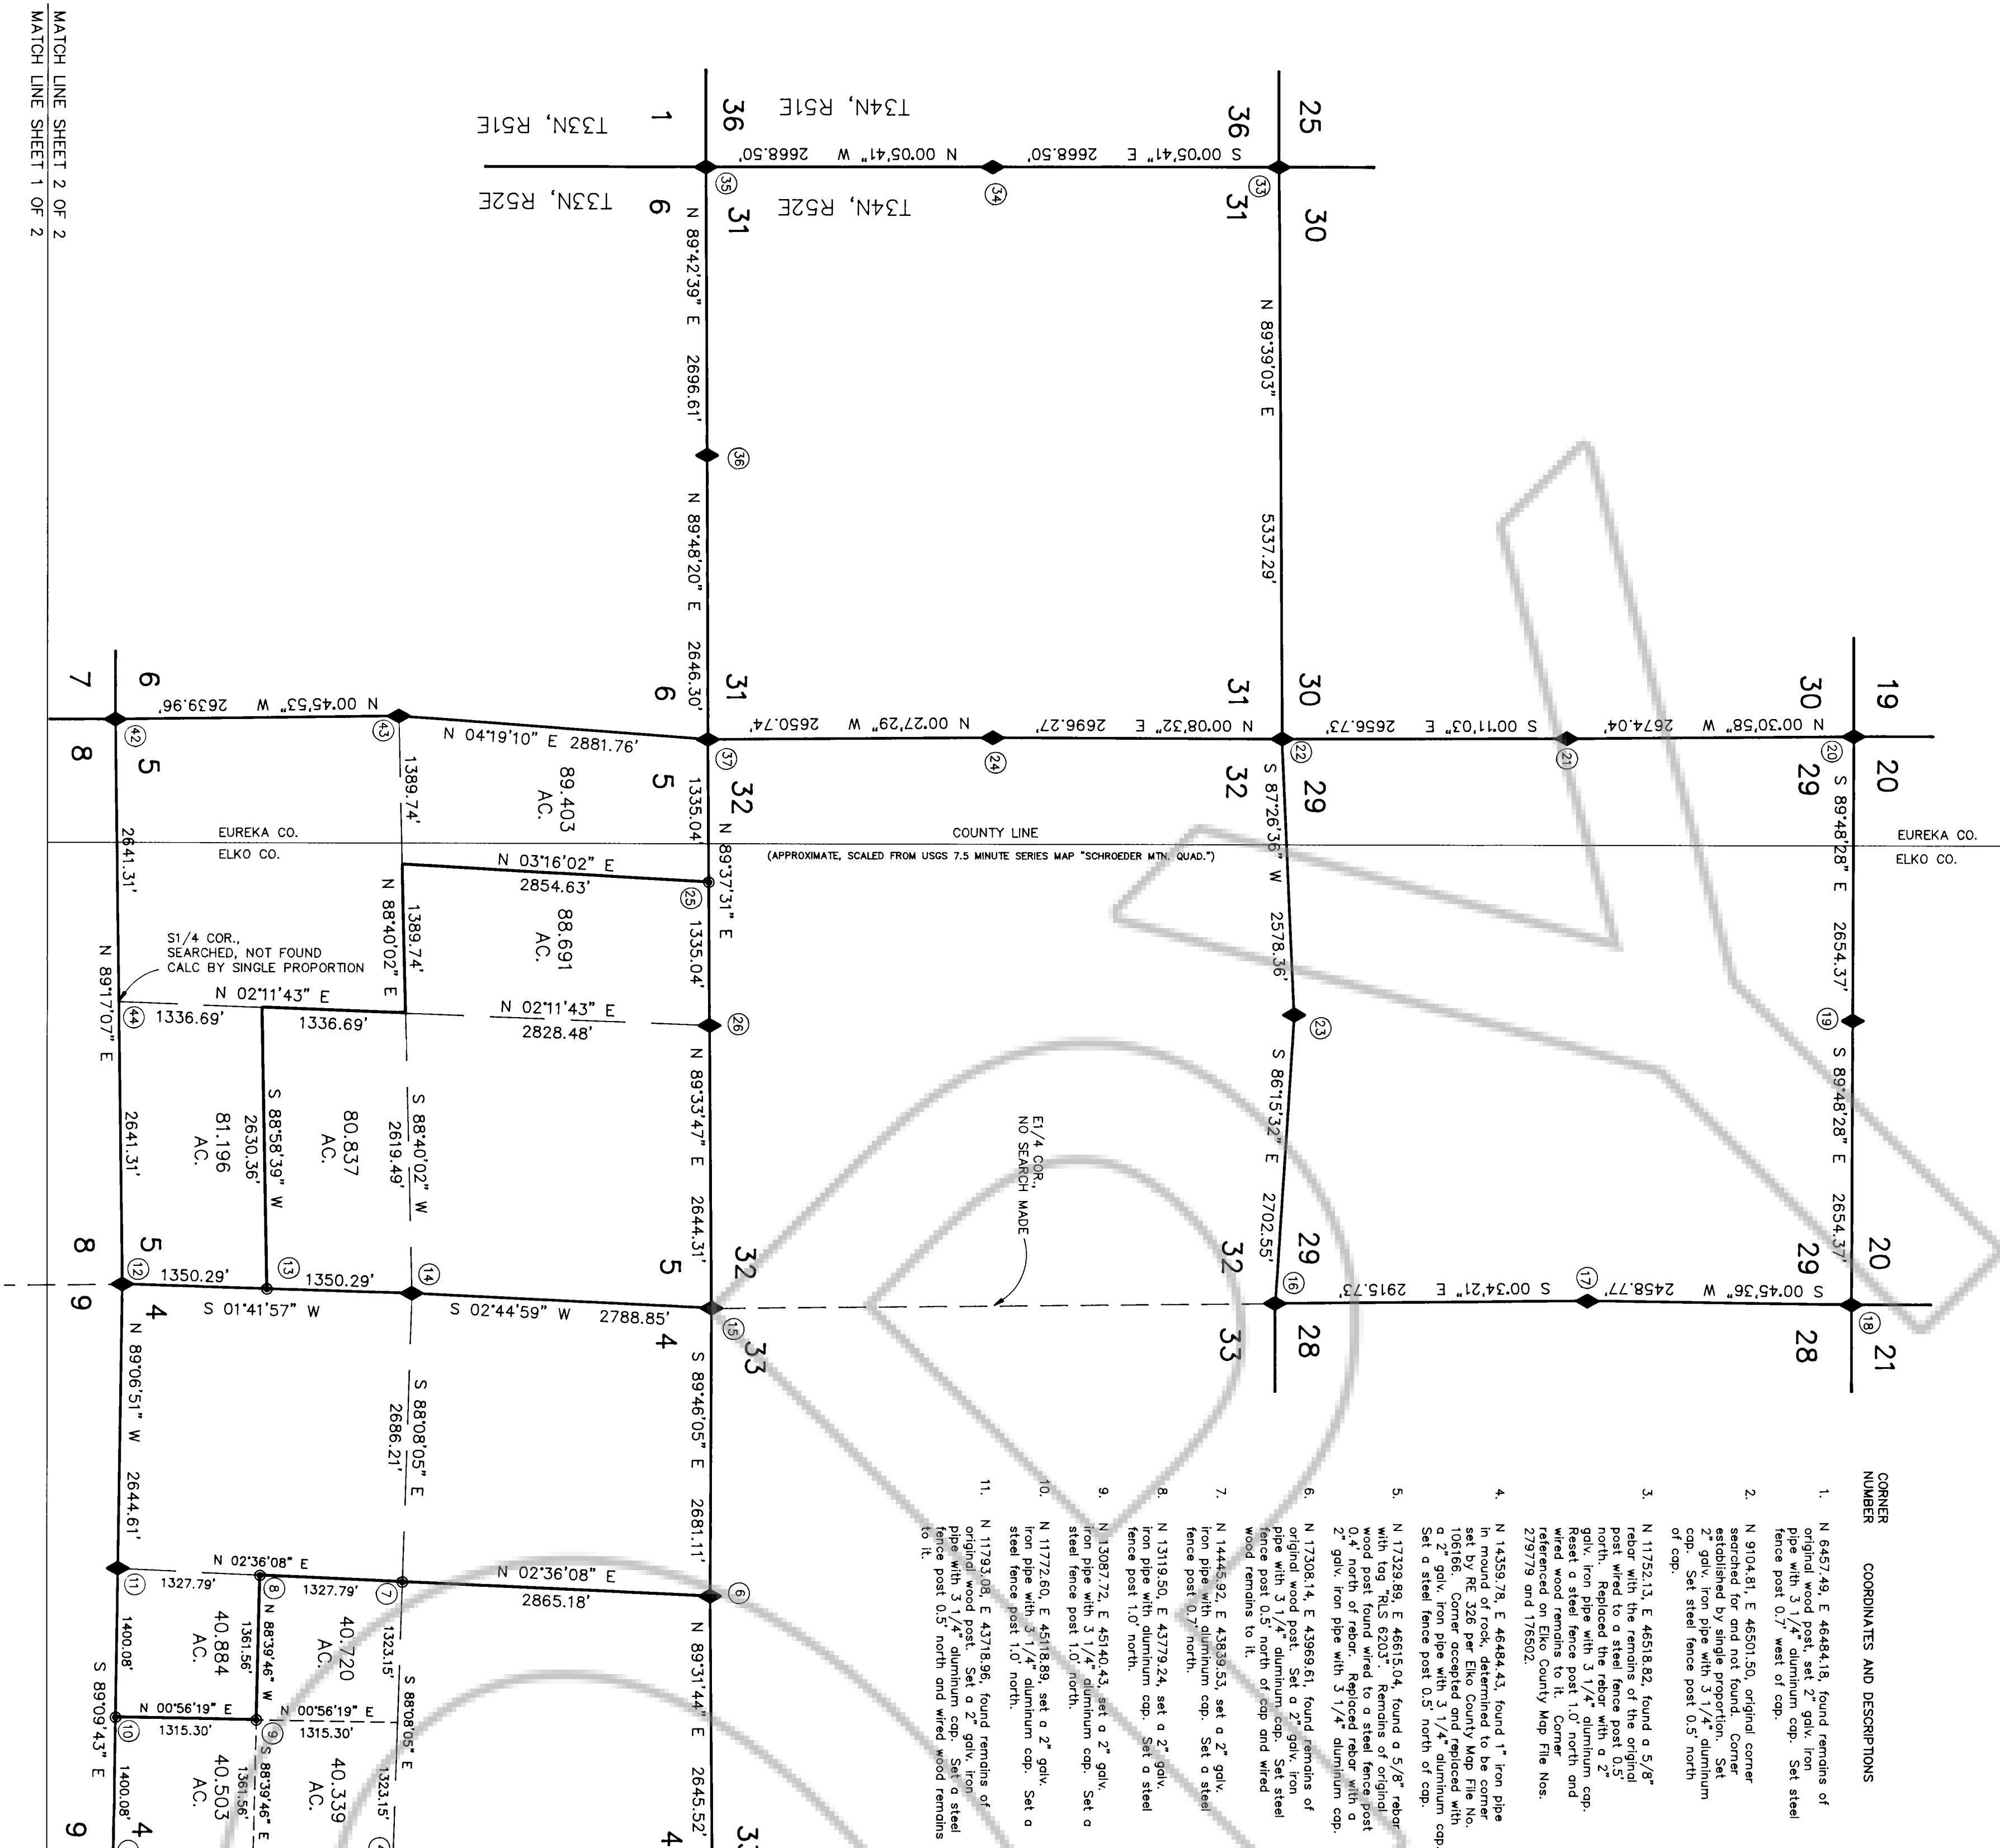

RECORD OF SURVEY

SECTIONS 3,4,5,6,9,10,14,15,16,21,22,23  
T. 33N., R. 52E., M.D.M. AND  
SECTIONS 29,30,31 AND 32  
T. 34N., R. 52E., M.D.M.  
ELKO AND EUREKA COUNTIES, NEVADA  
FOR NEWMONT GOLD COMPANY

CHILTON Engineering and Surveying, LTD  
421 Court Street  
Elko, Nevada 89801

92047 2/2